

# EFM<sup>®</sup>32

*... the world's most energy friendly microcontrollers*

## EFM32G880 Errata, Chip rev C

*F128/F64/F32*



This document describes errata for the latest revision of EFM32G880 devices.

# 1 Errata

This document contains information on the errata of the latest revision of this device. For errata on older revisions, please refer to the errata history for the device. The device datasheet explains how to identify chip revision, either from package marking or electronically.

In addition to the errata noted below, the errata for the ARM Cortex-M3 r2p0 ([www.arm.com](http://www.arm.com)) also applies to this device.

## 1.1 Chip revision C

**Table 1.1. Erratas**

ID	Title/Problem	Effect	Fix/Workaround
CMU6	<p><b>LFXO Digital External Mode</b></p> <p>LFXO ready flags are never set when LFXO is configured in Digital External Clock mode.</p>	<p>When LFXOMODE in CMU_CTRL is set to DIGEXTCLK the LFXORDY flag in CMU_STATUS and CMU_IF will not be set when the number of cycles set in LFXOTIMEOUT in CMU_CTRL has elapsed. Thus polling of this flag will not work. However, the clock propagates as normal. It is only the flag that is not set.</p>	<p>To detect that the clock has propagated through the ripple counter, write to any Asynchronous Register in any Low Energy peripheral and wait for SYNCBUSY for that register field to go low. Remember to enable the LE core clock and the clock for the LE peripheral you choose. For example, write 0xA5 to RTC_COMP0 and wait for COMP0 in RTC_SYNCBUSY to go low.</p>
EMU3	<p><b>EM4 current</b></p> <p>In EM4 the device may consume 700nA instead of 20nA.</p>	<p>If EM4 is issued within a 10µS-12µS window after the 1kHz RC oscillator rising edge transition the device will permanently consume 700nA.</p>	<p>There two possible workarounds for this issue.</p> <p>The first workaround is using the WDOG to identify the rising edge transition and add a delay before going into EM4. Write on the WDOG_CTRL register (for instance WDOG-&gt;CTRL =WDOG_CTRL_CLKSEL_ULFRCO) and wait for the SYNCBUSY to be released. The release of the SYNCBUSY happens on a rising edge transition of the 1Khz clock. After that insert a number of __NOP(); to cause a delay of 20µS (12µS plus margin). The number of __NOP(); will depend on the processor frequency. After the delay EM4 can be entered safely. Note: to implement this workaround the WDOG can not be locked, otherwise the registers will not be written.</p> <p>The second workaround is by outputting the ULFRCO on a pin (CMU_CLK0) using CMU_CTRL and CMU_ROUTE registers. That pin should then be configured as push pull with interrupt enable on rising edge, so the device can go to EM2 while it waits for the ULFRCO rising edge transition. When the interrupt occurs clear it and add a number of __NOP(); before entering EM4, as described in the first workaround. Note: the pin used to output the ULFRCO should be driven by an external source.</p>

ID	Title/Problem	Effect	Fix/Workaround
EMU4	<p><b>Sequencing of Analog and Digital Power</b></p> <p>Power-on Reset might fail if power is applied to IOVDD_x or VDD_DREG before AVDD_x</p>	<p>The device might lock up if power is applied to IOVDD_x or VDD_DREG pins before AVDD_x pins during power up. This lock-up state can be exited by removing power to the device followed by a power up sequence according to what is described in the workaround.</p>	<p>Make sure that the power on the AVDD_x pins ramp earlier or at the same time as the power on IOVDD_x and VDD_DREG during power up. Practical schematic recommendations for this workaround are given in the EFM32 Application Note "AN0002 Hardware Design Considerations".</p>
RTC1	<p><b>RTC PRS output</b></p> <p>The RTC PRS output might cause false triggers</p>	<p>If the RTC is selected as a PRS producer there might occur glitches which will accidentally cause false triggers.</p>	<p>Do not use the RTC as a PRS producer, instead use one of the other timer sources (e.g. TIMER0).</p>
USART1	<p><b>U(S)ART Double Buffer</b></p> <p>Transmission control through TXDATAx and TXDOUBLEX does not work with data double buffering.</p>	<p>When a frame is loaded into the transmission shift register, transmission control bits are always taken from outer buffer element. If only one frame is in the U(S)ART buffer, the content of the buffer elements is equivalent, and transmission control bits work as specified. If two frames are in the buffer however, the control bits for the frame in the outer buffer are used for transmitting the frame in inner buffer. This is not a problem for frames consisting of more than 9 bits, since these large frames occupy both the inner and outer buffer elements.</p>	<p>If using transmission control bits in registers TXDATAx or TXDOUBLEX make sure there are not more than one frame in the U(S)ART buffer at a time, or that the control bits are equal. When TXBL in U(S)ARTn_CTRL is cleared, the TXBL status and interrupt flags in U(S)ARTn_STATUS and U(S)ARTn_IF respectively tell when the buffer is empty. When using transmission control bits, a single frame can then be loaded into the USART for transmission.</p>
WDOG2	<p><b>WDOG does not freeze in EM2/EM3</b></p> <p>The WDOG keeps running in EM2 and EM3 even though EM2RUN and EM3RUN bits in WDOG_CTRL are programmed to 0.</p>	<p>If the WDOG is enabled when entering EM2 or EM3, a WDOG reset will occur unless the system wakes up from EM2/EM3 (by interrupt) and clears the WDOG timer before the WDOG times out.</p>	<p>Disable WDOG before entering EM2/EM3 by writing EN bit in WDOG_CTRL to 0. This requires that the WDOG configuration is unlocked (LOCK bit in WDOG_CTRL = 0). If WDOG configuration is locked, the WDOG will remain enabled in EM2/EM3 and the system must wake up the device from EM2/EM3 and clear WDOG before WDOG times out.</p>

## 2 Revision History

### 2.1 Revision 1.40

November 17th, 2010

Added EMU4.

### 2.2 Revision 1.30

October 26th, 2010

Added EMU3 and RTC1.

### 2.3 Revision 1.20

August 31st, 2010

Removed Erratas not valid for chip revision C.

Added WDOG2.

### 2.4 Revision 1.10

June 25th, 2010

Removed ADC7, DAC6, and LCD3.

Added ACMP1, ADC12-ADC13, CMU6-CMU7, DAC7, LEUART3, LETIMER1, TIMER1, USART2-USART11, VCMP1-VCMP2.

### 2.5 Revision 1.00

April 23rd, 2010

Removed ADC\_VCM errata.

Updated the erratas which are to be fixed in chip revision C.

## **2.6 Revision 0.10**

April 8th, 2010

Initial preliminary release.

## A Disclaimer and Trademarks

### A.1 Disclaimer

*Energy Micro AS intends to provide customers with the latest, accurate, and in-depth documentation of all peripherals and modules available for system and software implementers using or intending to use the Energy Micro products. Characterization data, available modules and peripherals, memory sizes and memory addresses refer to each specific device, and "Typical" parameters provided can and do vary in different applications. Application examples described herein are for illustrative purposes only. Energy Micro reserves the right to make changes without further notice and limitation to product information, specifications, and descriptions herein, and does not give warranties as to the accuracy or completeness of the included information. Energy Micro shall have no liability for the consequences of use of the information supplied herein. This document does not imply or express copyright licenses granted hereunder to design or fabricate any integrated circuits. The products must not be used within any Life Support System without the specific written consent of Energy Micro. A "Life Support System" is any product or system intended to support or sustain life and/or health, which, if it fails, can be reasonably expected to result in significant personal injury or death. Energy Micro products are generally not intended for military applications. Energy Micro products shall under no circumstances be used in weapons of mass destruction including (but not limited to) nuclear, biological or chemical weapons, or missiles capable of delivering such weapons.*

### A.2 Trademark Information

Energy Micro, EFM32, EFR, logo and combinations thereof, and others are the registered trademarks or trademarks of Energy Micro AS. ARM, CORTEX, THUMB are the registered trademarks of ARM Limited. Other terms and product names may be trademarks of others.

## B Contact Information

### B.1 Energy Micro Corporate Headquarters

Postal Address	Visitor Address	Technical Support
Energy Micro AS P.O. Box 4633 Nydalen N-0405 Oslo NORWAY	Energy Micro AS Sandakerveien 118 N-0484 Oslo NORWAY	support.energymicro.com Phone: +47 40 10 03 01

**www.energymicro.com**

Phone: +47 23 00 98 00

Fax: + 47 23 00 98 01

### B.2 Global Contacts

Visit **www.energymicro.com** for information on global distributors and representatives or contact **sales@energymicro.com** for additional information.


Americas	Europe, Middle East and Africa	Asia and Pacific
<a href="http://www.energymicro.com/americas">www.energymicro.com/americas</a>	<a href="http://www.energymicro.com/emea">www.energymicro.com/emea</a>	<a href="http://www.energymicro.com/asia">www.energymicro.com/asia</a>

# Table of Contents

- 1. Errata ..... 2
  - 1.1. Chip revision C ..... 2
- 2. Revision History ..... 4
  - 2.1. Revision 1.40 ..... 4
  - 2.2. Revision 1.30 ..... 4
  - 2.3. Revision 1.20 ..... 4
  - 2.4. Revision 1.10 ..... 4
  - 2.5. Revision 1.00 ..... 4
  - 2.6. Revision 0.10 ..... 5
- A. Disclaimer and Trademarks ..... 6
  - A.1. Disclaimer ..... 6
  - A.2. Trademark Information ..... 6
- B. Contact Information ..... 7
  - B.1. Energy Micro Corporate Headquarters ..... 7
  - B.2. Global Contacts ..... 7

## List of Tables

1.1. Erratas ..... 2

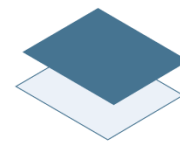

**ENERGY**<sup>®</sup>  
*micro*

*Energy Micro AS  
Sandakerveien 118  
P.O. Box 4633 Nydalen  
N-0405 Oslo  
Norway*

*[www.energymicro.com](http://www.energymicro.com)*